



Calibration Instructions X320 Indicator

To Zero the Display

- ⊕ Press **GROSS/NET** and **POWER** key at the same time holding both for 3-4 seconds. The display will beep twice and then show **SETUP**
- ⊕ The display will then show **bUild**
- ⊕ Stroke **ZERO** Display will show **OPTion**
- ⊕ Stroke **ZERO** again Display will show **CAL**
- ⊕ Stroke **TARE** Display will show **ZerO**
- ⊕ Stroke **GROSS/NET** Display will show a weight
- ⊕ Stroke **Print** Display will show **Z. in P**, when complete will show **0.000kg** exactly
- ⊕ Stroke the **ZERO** button **NINE** times until the display shows **-END-**
- ⊕ Stroke **f** Display will return to normal weighing

Load and weigh the vehicle at a weighbridge, obtaining the NETT Payload

- ⊕ Stroke **GROSS/NET** and **POWER KEY** at the same time holding both for 3-4 seconds The Display will beep twice and then show **bUild**
- ⊕ Stroke **ZERO** Display will show **OPTion**
- ⊕ Stroke **ZERO** again Display will show **CAL**
- ⊕ Stroke **TARE** twice Display will show **SPAN**
- ⊕ Stroke **GROSS/NET** Display will show **CLr.L n**
- ⊕ Stroke **f** Display will show **flashing** digits
- ⊕ Stroke **GROSS/NET** The display will show a **flashing** digit on the left side
- ⊕ Stroke **GROSS/NET** To move the flashing digit along the line of digits
- ⊕ Stroke **PRINT** To adjust the flashing digit between 1 and 9, Repeat both steps until the correct weight is shown
- ⊕ Press **f** Display will show **S. in P** then flash correct weight
- ⊕ Stroke the **ZERO** button **NINE** times until the display shows **-END-**
- ⊕ Stroke **f** Display will return to standard weighing mode

